



Intel® 875P Chipset

Specification Update

Intel® 82875P Memory Controller Hub (MCH)

February 2004

Notice: The Intel® 82875P MCH may contain design defects or errors known as errata which may cause the product to deviate from published specifications. Current characterized errata are documented in this Specification Update.

Document Number: 252526-003

INFORMATION IN THIS DOCUMENT IS PROVIDED IN CONNECTION WITH INTEL® PRODUCTS. NO LICENSE, EXPRESS OR IMPLIED, BY ESTOPPEL OR OTHERWISE, TO ANY INTELLECTUAL PROPERTY RIGHTS IS GRANTED BY THIS DOCUMENT. EXCEPT AS PROVIDED IN INTEL'S TERMS AND CONDITIONS OF SALE FOR SUCH PRODUCTS, INTEL ASSUMES NO LIABILITY WHATSOEVER, AND INTEL DISCLAIMS ANY EXPRESS OR IMPLIED WARRANTY, RELATING TO SALE AND/OR USE OF INTEL PRODUCTS INCLUDING LIABILITY OR WARRANTIES RELATING TO FITNESS FOR A PARTICULAR PURPOSE, MERCHANTABILITY, OR INFRINGEMENT OF ANY PATENT, COPYRIGHT OR OTHER INTELLECTUAL PROPERTY RIGHT. INTEL PRODUCTS ARE NOT INTENDED FOR USE IN MEDICAL, LIFE SAVING, OR LIFE SUSTAINING APPLICATIONS.

Intel may make changes to specifications and product descriptions at any time, without notice.

Designers must not rely on the absence or characteristics of any features or instructions marked "reserved" or "undefined." Intel reserves these for future definition and shall have no responsibility whatsoever for conflicts or incompatibilities arising from future changes to them.

The Intel® 82875P chipset MCH may contain design defects or errors known as errata which may cause the product to deviate from published specifications. Current characterized errata are available on request.

Contact your local Intel sales office or your distributor to obtain the latest specifications and before placing your product order.

Intel and the Intel logo are trademarks or registered trademarks of Intel Corporation or its subsidiaries in the United States and other countries.

*Other names and brands may be claimed as the property of others.

Copyright © 2003–2004, Intel Corporation



Contents

Revision History4

Preface.....5

Errata9

Specification Changes11

Specification Clarifications13

Documentation Changes15

Revision History

Rev.	Draft/Changes	Date
-001	<ul style="list-style-type: none">Initial Release.	April 2003
-002	<ul style="list-style-type: none">Added DC levels spec update and clarification	September 2003
-003	<ul style="list-style-type: none">Added erratum1, FSB800 / DDR333 Running at 320 MHz Refresh TimingRemoved DC levels specification (Specification Clarification 1 and Specification Change 1 that were in previous Specification Update revision) as this information has been incorporated into the <i>Intel® 875P Chipset Datasheet, Revision -002</i>.	February 2004

Preface

This public document is an update to the specifications contained in the documents listed in the following Affected Documents/Related Documents table. It is a compilation of device and document errata and specification clarifications and changes, and is intended for hardware system manufacturers and for software developers of applications, operating system, and tools.

Information types defined in the Nomenclature section of this document are consolidated into this update document and are no longer published in other documents.

Affected Documents/Related Documents

Document Title	Document Number
Intel® 875P Chipset Datasheet:	252525-002

Nomenclature

Errata are design defects or errors. Errata may cause the behavior of the Intel 82875P MCH to deviate from published specifications. Hardware and software designed to be used with any given stepping must assume that all errata documented for that stepping are present on all devices.

Specification Changes are modifications to the current published specifications. These changes will be incorporated in the next release of the specifications.

Specification Clarifications describe a specification in greater detail or further highlight a specification's impact to a complex design situation. These clarifications will be incorporated in the next release of the specifications.

Documentation Changes include typos, errors, or omissions from the current published specifications. These changes will be incorporated in the next release of the specifications.

Component Identification via Programming Interface

The 82875P MCH may be identified by the following register contents:

Stepping	Vendor ID ¹	Device ID ²	Revision Number ³
A2	8086h	2560h	02h

NOTES:

1. The Vendor ID corresponds to bits 15:0 of the Vendor ID Register located at offset 00–01h in the PCI function 0 configuration space.
2. The Device ID corresponds to bits 15:0 of the Device ID Register located at offset 02–03h in the PCI function 0 configuration space.
3. The Revision Number corresponds to bits 7:0 of the Revision ID Register located at offset 08h in the PCI function 0 configuration space.

Component Marking Information

The 82875P MCH may be identified by the following component markings:

Stepping	Q-Spec	S-Spec	Top Marking	Notes
A2	QE44	SL744	RG82875	

Summary Table of Changes

The following table indicates the Specification Changes, Errata, Specification Clarifications or Documentation Changes that apply to the listed 82875P MCH steppings. Intel may intend to fix some of the errata in a future stepping of the component and to account for the other outstanding issues through documentation or Specification Changes as noted. This table uses the following notations:

Codes Used in Summary Table

X:	Errata that applies to this stepping.
Doc:	Document change or update that will be implemented.
PlanFix:	This erratum may be fixed in a future stepping of the product.
Fixed:	This erratum has been previously fixed.
NoFix:	There are no plans to fix this erratum.
(No mark) or (Blank Box):	This erratum is fixed in listed stepping or specification change does not apply to listed stepping.

Shaded: This item is either new or modified from the previous version of the document

NO.	A2	PLANS	ERRATA
1	X	NoFix	FSB800 / DDR333 Running at 320 MHz Refresh Timing

NO.	SPECIFICATION CHANGES
	There are no specification changes in this Specification Update revision.

NO.	SPECIFICATION CLARIFICATIONS
	There are no specification clarifications in this Specification Update revision.

NO.	DOCUMENTATION CHANGES
	There are no documentation changes in this Specification Update revision.

This page is intentionally left blank.

Errata

1. FSB800 / DDR333 Running at 320 MHz Refresh Timing Erratum

Problem: When a system is configured with an 800 MHz FSB process and DDR333 DIMM(s), the chipset's memory interface operates at 320 MHz. At this specific memory frequency, the chipset issues refresh cycles at a slower rate than the DDR333 JEDEC specification documents.

Chipset, with memory frequency at 320 MHz, issues refresh cycles every:

8.1 μ s with 256-Mb and 512-Mb memory technology

16.2 μ s with 64-Mb and 128-Mb memory technology

JEDEC spec for DDR333 devices is:

7.8 μ s with 256-Mb and 512-Mb memory technology

15.6 μ s with 64-Mb and 128-Mb memory technology

Implication: None

Workaround: None

Status: No silicon fix planned. Intel has contacted the major memory suppliers about this issue and has modified the DDR validation specification that Intel uses to test memory. Feedback from memory suppliers is that they can meet Intel's updated DDR validation specification.

This page is intentionally left blank.

Specification Changes

There are no Specification Changes in this Specification Update revision.

This page is intentionally left blank.

Specification Clarifications

There are no Specification Clarifications in this Specification Update revision.

This page is intentionally left blank.

Documentation Changes

There are no documentation changes in this Specification Update revision.